



Datenblatt für Antriebe

RETROFIT FMB130 MACHINE | SCHINDLER 3100/3300/5300

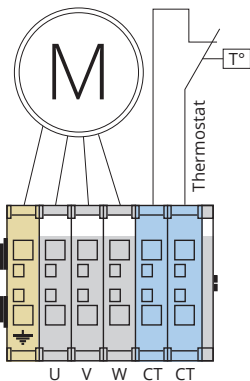


Motor Connection

WAGO 262
Cable cross-section: 4mm²
Stripping length required: 9-10mm
CT – Temperature Contact

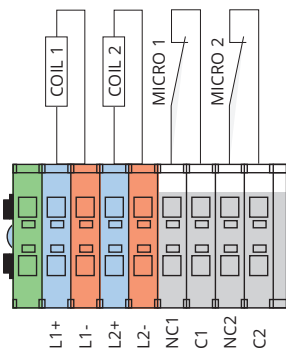

Brake Connection

WAGO 260
Cable cross-section: 1.5mm²
Stripping length required: 8-9mm
L1+/L1- : Brake Coil 1
L2+/L2- : Brake Coil 2
NC1: Contact Normally Closed MicroSwitch 1
C1: Contact Common MicroSwitch 1
NC2: Contact Normally Closed MicroSwitch 2
C2: Contact Common MicroSwitch 2
Bremsspannung: 207 VDC ohne Übererregung

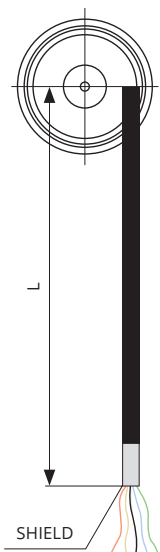

Encoder Connection

ECN1313
2048/5v/EnDat

SIGNAL	+5,25V	Shield 0V	A+	A-	B+	B-	Clock+
COLOR	Brown/Green	Silver	Green/Black	Yellow/Black	Blue/Black	Red/Black	Violet

SIGNAL	Clock-	+Data	-Data	Up Sensor	0V Sensor	Com(0V)	Shield
COLOR	Yellow	Grey	Pink	Blue	White	White/Green	Silver